

**CRS No. A-00001**

Address: 299 Bowers Beach Road

Name: Dwelling, 299 Bowers Beach Road

Tax Parcels: 8-00-12216-01-1000-00001

8-00-12216-01-1001-00001

Date of Construction/Major Alterations: ca. 1940/ca. 1948/ca. 1950/ ca. 1970

Time Period: 1940-1960±, Suburbanization and Early Ex-urbanization

Geographic Zone: Upper Peninsula

Historic Period Theme(s): Architecture, Engineering, and Decorative Arts (Residential Architecture); Agriculture; and Settlement Patterns and Demographic Changes (Community Development)

*Description*

This residential property is located on the northwest side of Bowers Beach Road in South Murderkill Hundred, Kent County, Delaware, south of the unincorporated community of Little Heaven. The property includes a *circa*-1940 side-gable dwelling, a *circa*-1950 garage, three chicken houses, and a partially collapsed shed. The one-and-one-half-story dwelling sits back from Bowers Beach Road and faces southeast, parallel to the roadway. According to the current owner, the dwelling was moved to its present location in 1948. The dwelling's original form appears to have consisted of a side-gable main block with a one-story full-width, shed-roof extension on the south (façade) elevation. Alterations to the dwelling include the construction of a shed-roof addition on the east elevation, the construction of a screened-in porch on the southwest corner, and the enclosure of the entry on the façade (south) elevation. The dwelling rests on a concrete block foundation. Asbestos shingles cover the exterior walls of the dwelling, which is capped by a side-gable roof with a shed-roof front extension sheathed in asphalt shingles. An interior brick chimney is centrally located along the roof's ridge. The dwelling's main entry, centrally located in the façade, is flanked by one-over-one light, double-hung sash wood windows. A shed roof hood shelters the entry, which is accessed by two brick steps flanked with a wrought iron railing. The dwelling is lit by one-over-one light double-hung sash, wood windows, hung singly or in pairs. The one-story screened-in side porch is situated at the southwest corner of the dwelling. The porch is framed with wood screens, rests on a concrete block foundation, and has a poured concrete deck. A secondary entry consisting of a single-leaf, screen door is located in the north elevation of the screened-in porch. A one-bay-wide by two-bay-deep addition extends from the east elevation of the dwelling. The addition rests on a concrete block foundation, is clad in asbestos shingle siding, and has a hipped roof sheathed with asphalt shingles. The addition is also lit by one-over-one light double-hung sash, wood windows. A secondary entry is located in the north elevation of the addition.

A *circa*-1950, three-bay, concrete block garage is located to the west of the dwelling. A side gable roof, sheathed in sheets of standing seam metal and featuring asbestos-shingle siding on the gable ends, caps the building. Three sliding wood garage doors with twelve lights hung on an overhead metal track provide access to the interior. The garage is lit by a variety of window types including one-over-one light, double-hung sash, wood and two-light, fixed-sash, and aluminum. Additions to the garage include an asbestos-shingle-clad addition on the west elevation and a shed roof addition from the north elevation. A shed roof entry porch shelters a single-leaf pedestrian entry located in the east elevation of the shed-roof addition.

The property also includes three chicken houses and a shed that has partially collapsed. The largest of the chicken houses (Chicken house 1) is located northeast of the dwelling and faces

southeast towards Bowers Beach Road. The oldest portion of the building (ca. 1950) is a centrally located, front-gable structure clad in clapboard. Shed roof wings clad with wood sheets extend from the east and west elevations of the gabled structure. The long, rectangular building is primarily lit by rectangular one-light awning-sash wood windows. A 12-light metal-framed window and two one-over-one light, aluminum sash windows also light the south (front) elevation. Four pedestrian entries are spaced throughout the south elevation. Originally this building served as a chicken house, but it was later converted into apartments. The building now stands empty.

The *circa*-1960 Chicken house 2 lies north of Chicken house 1. Chicken house 2 measures two bays wide and is clad with sheets of wood. The shed roof that caps the building is sheathed with corrugated metal. A batten wood door and a rectangular opening covered with chicken wire are located in the west (front) elevation. The building appears to have no additional openings. Chicken house 3 is located northeast of the dwelling and is obscured by overgrowth. The partially collapsed modern shed is located south of Chicken house 3. A concrete pad is located east of Chicken house 3.

An elongated U-shaped gravel driveway separates the dwelling from the garage and Chicken house 1. The property is landscaped with numerous plantings and several mature trees.

#### *Historical Narrative*

According to the present-day owner, Jean Roberts, the dwelling was moved from where the Rainbow Inn used to be in Little Heaven to this location in 1948. Mrs. Roberts indicated that her family purchased the property in the late 1940s. According to deed records, the land on the north side of Bowers Beach Road was unoccupied in 1930, when it was acquired by Charles W. and Lida Mae Baker (Kent County Deed Book V13:167). The Bakers conveyed the property to Russell C. and Bertha M. Moore in 1948. The Moore's later acquired additional land surrounding this tract in 1952 (Kent County Deed Book E20:92). Aerial photographs, accessed via the Delaware DataMIL website, confirm the dwelling, the garage, and possibly the chicken house closest to the road (Chicken house 1) were in place as of 1954. It is unclear when the chicken operations ceased on the property. The chicken house closest to Bowers Beach Road (Chicken house 3) was most recently used as apartments although the building is now vacant.

#### *National Register Evaluation*

The property at 299 Bowers Beach Road was evaluated as a Side-Gable Cottage as identified in the *Historic Context for the DuPont Highway, U.S. Route 113, Kent and Sussex Counties, Delaware* (John Milner Associates, Inc. 2005). Although located along the northwest side of Bowers Beach Road amidst other mid- to late-twentieth-century strip development, the property has no potential to yield information on residential development practices, as it was moved to its present location in 1948 and therefore is not eligible for listing in the National Register under Criterion A. Based on the background research conducted for this project, the property does not appear to be associated with an individual of historic importance; therefore, the property is not eligible under Criterion B. The dwelling is an example of a side-gable cottage with a few modifications including the construction of the screened-in side porch and the addition extending from the east elevation. The dwelling is representative of an early-twentieth-century form commonly found throughout the area. The dwelling is not architecturally significant and, due to the moving of the dwelling to its present-day location in 1948, the dwelling no longer retains

integrity of location. The dwelling is not a notable example of the architecture of its time, nor does it appear to include innovative building technology or important achievements in architecture or engineering; therefore, the property is not eligible for National Register listing under Criterion C. The property does not appear to possess the potential to yield information on building practices or methods of construction; therefore, the property does not appear to be eligible for listing under Criterion D. Due to lack of significance, the property at 299 Bowers Beach Road is not eligible for listing in the National Register for architecture.

The property was also evaluated as an agricultural complex. The property no longer conveys significance in relation to the broiler chicken industry in southern Kent County and thus is not eligible under Criterion A for trends in agriculture. Based on background research, the property does not appear to be associated with the productive life of an individual important to the agricultural history of southern Delaware; therefore, the property is not eligible under Criterion B. While the original fenestration pattern of the outbuildings appears intact and the positioning of outbuildings remains in place, the buildings are not significant under Criterion C, as they are common examples of mid-twentieth-century poultry buildings found throughout southern Delaware. Therefore, the property is not eligible for listing in the National Register under Criterion C. The buildings do not appear to have potential to yield information on building technology; thus the property does not appear to be eligible for listing under Criterion D. Due to lack of significance, the property at 299 Bowers Beach Road is not eligible for listing in the National Register for agriculture.

The property is one of approximately 16 properties located amidst former farmland that was subdivided for residential construction during the late 1940s to mid 1950s and again in the 1970s. The majority of the residences along Bowers Beach Road, east of U.S. 113, were constructed ca. 1950 to present-day, with earlier examples that were moved to the small rectangular lots from other locations. These dates reflect a wide range of construction patterns and thus, the development is not an early example of the common twentieth-century trend of subdividing lands located close to major highways. Therefore, the property is not eligible under Criterion A. The strip development does not appear to be associated with persons of critical importance to the historic development of the area; therefore, the property is not eligible for listing under Criterion B. The strip development contains dwellings that were constructed during a variety of time periods and include a wide range of forms. The development lacks a cohesive identity, and thus, the grouping could not be considered eligible under Criterion C as a distinguishable entity whose components lack individual distinction. The development does not appear to possess the potential to yield information on twentieth-century land development practices; therefore, the development does not appear to be eligible for listing under Criterion D.

CRS No. A-00001




A-00001. Photograph 1: Overview of 299 Bowers Beach Road (dwelling and garage) looking west. The dwelling was moved to this location in 1948.



A-00001. Photograph 2: Dwelling, south and east elevations, looking west. The dwelling is clad in asbestos shingles and is lit by one-over-one light, double-hung sash, wood windows.




A-00001. Photograph 3: Dwelling, west elevation, looking east. Note the screened-in porch to right.

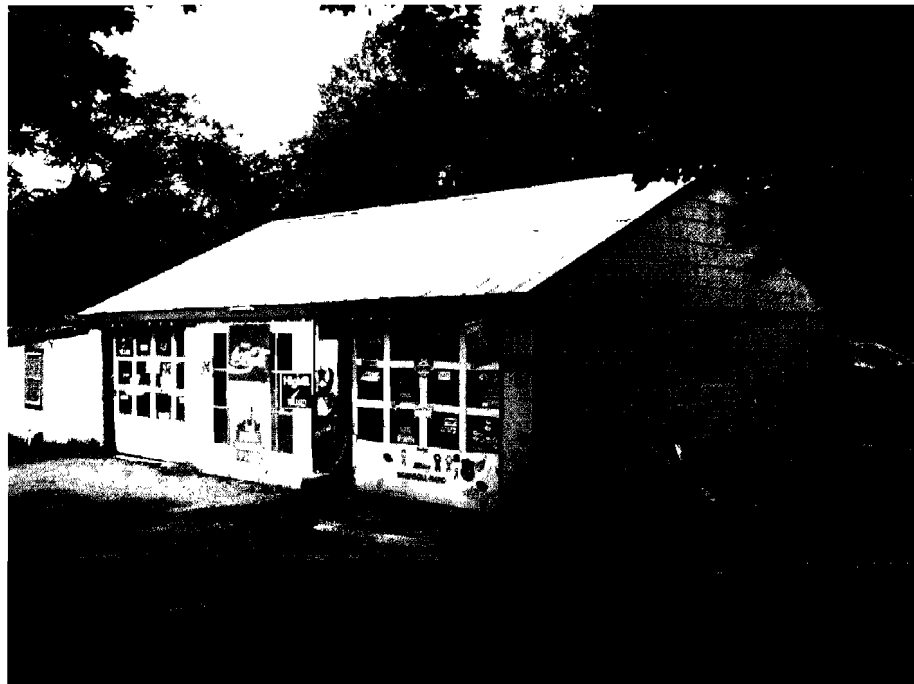

A-00001. Photograph 4: Garage, south and east elevations, looking west. Shed-roof additions just visible at the extreme left and right sides of the photograph.



A-00001. Photograph 5: Chicken house 1, south and east elevations, looking west. Note the front-gable center section of the building, which appears to predate the east and west wings. This chicken house was later converted into apartments.

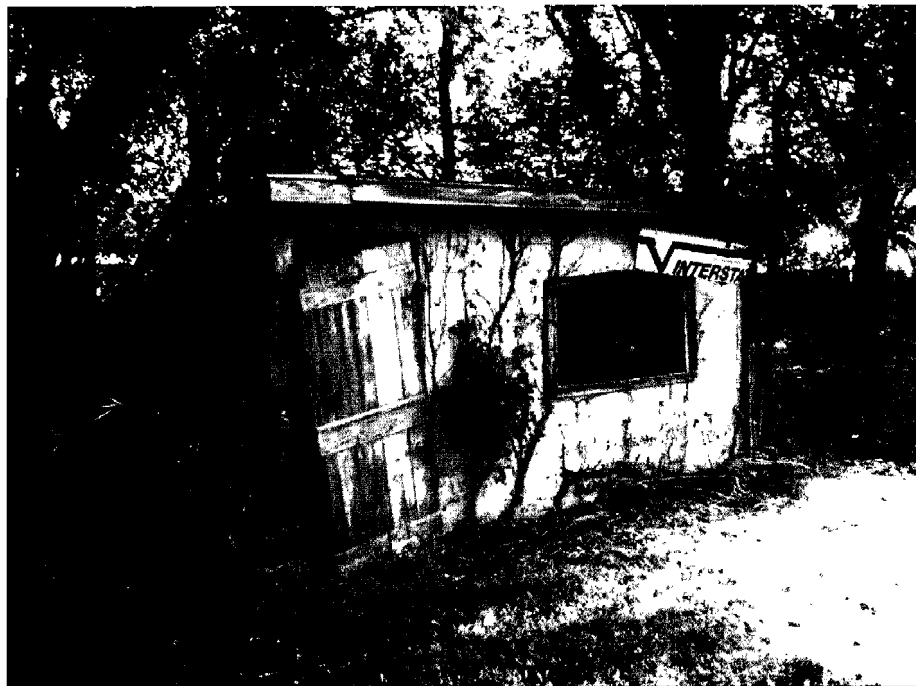


A-00001. Photograph 6: Chicken house 2, north and west elevations, looking southeast. This chicken house is in poor condition and is vacant.


CRS No. A-00001



A-00001. Photograph 7: Chicken house 3, south elevation, looking northeast. Ivy and other overgrown vegetation obscure this chicken house.

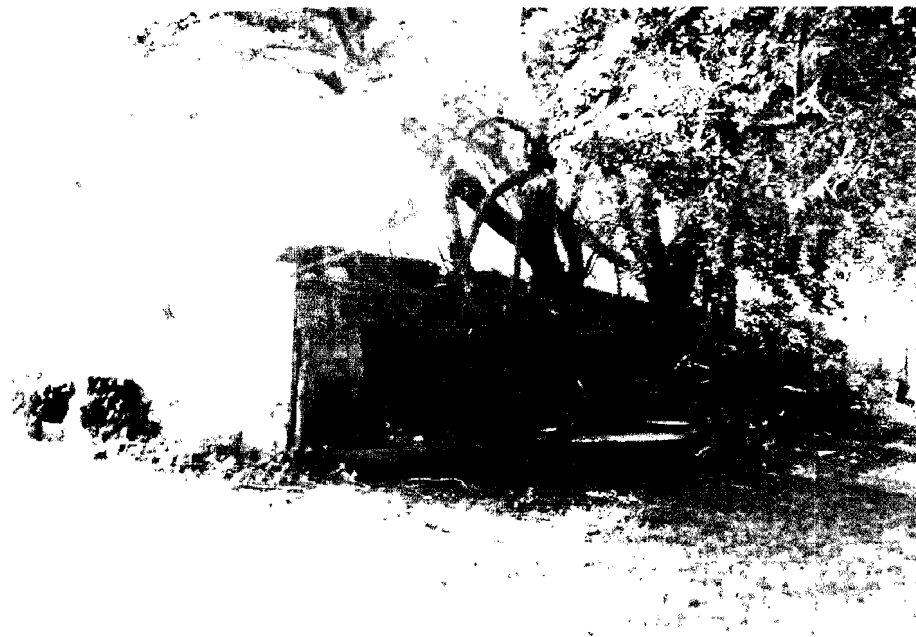

A-00001. Photograph 8: Shed, west and south elevations, looking north. This modern shed is clad in plywood and is partially collapsed.

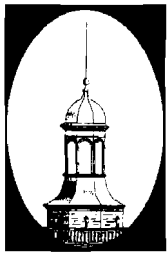

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
PROPERTY IDENTIFICATION FORM

CRS #	A-00001
SPO Map	12-13-18
Hundred	South Murderkill
Quad	Frederica
Other	8-00-12216-01-10000-00001

1. HISTORIC NAME/FUNCTION: Dwelling, 299 Bowers Beach Road
2. ADDRESS/LOCATION: 299 Bowers Beach Road
3. TOWN/NEAREST TOWN: Little Heaven vicinity? ☒
4. MAIN TYPE OF RESOURCE:      building ☒      structure ☐      site ☐      object ☐  
   landscape ☐      district ☐
5. MAIN FUNCTION OF PROPERTY: Residential
6. PROJECT TITLE/ REASON FOR SURVEY (if applicable):  
SR1, Little Heaven Grade Separated Intersection Improvements


7. ADDITIONAL FORMS USED:

#:	Form:	List property types:
1	CRS 2 Main Building Form	Dwelling
4	CRS 3 Secondary Building Form	Garage, 3 chicken sheds
	CRS 4 Archaeological Site Form	
	CRS 5 Structure (Building-Like) Form	
	CRS 6 Structure (Land Feature) Form	
	CRS 7 Object Form	
	CRS 8 Landscape Elements Form	
1	CRS 9 Map Form	N/A
	CRS 14 Potential District Form	

8. SURVEYOR INFORMATION:

Surveyor name: Catherine M. Dluzak/Architectural Historian

Principal Investigator name: Barbara Frederick/Sr. Architectural Historian

Principal Investigator signature: 

Organization: A.D. Marble & Company Date: 09/24/2008



## 9. OTHER NOTES OR OBSERVATIONS:

CRS# A-00001

Property also includes tax parcel 8-00-12216-01-1001-00001.

Property owner indicated that the property has been under her family's ownership since the late 1940s. Two dwellings to the west, 249 Bowers Beach Road (A-00002, Tax parcel 8-00-12216-01-0901-00001) and 239 Bowers Beach Road (A-00003, Tax parcel 8-00-12216-01-0900-00001) are also under her family's ownership.

According to the property owner, the dwelling was moved to this location from the south side of Bowers Beach Road near its intersection with U.S. 113/SR 1 in the vicinity of where the Rainbow Inn (demolished within the past few years) used to be. This occurred in 1948, approximately the same time the family purchased the property. The property also includes a *circa*-1950 garage and chicken house and two additional *circa*-1960 chicken houses.

## 10. STATE HISTORIC CONTEXT FRAMEWORK (check all appropriate boxes; refer to state management plan(s)):

## a) Time period(s)

- ☐ Pre-European Contact  
☐ Paleo-Indian  
☐ Archaic  
☐ Woodland I  
☐ Woodland II

- ☐ 1600-1750 ∇ Contact Period (Native American)  
☐ 1630-1730 ∇ Exploration and Frontier Settlement  
☐ 1730-1770 ∇ Intensified and Durable Occupation  
☐ 1770-1830 ∇ Early Industrialization  
☐ 1830-1880 ∇ Industrialization and Early Urbanization  
☐ 1880-1940 ∇ Urbanization and Early Suburbanization  
☒ 1940-1960 ∇ Suburbanization and Early Ex-urbanization

## b) Geographical zone


- ☐ Piedmont  
☒ Upper Peninsula  
☐ Lower Peninsula/Cypress Swamp  
☐ Coastal  
☐ Urban (City of Wilmington)

## c) Historic period theme(s)

- |   |   |
|---|---|
| <input checked="" type="checkbox"/> Agriculture | <input type="checkbox"/> Transportation and Communication                         |
| <input type="checkbox"/> Forestry               | <input checked="" type="checkbox"/> Settlement Patterns and Demographic Changes   |
| <input type="checkbox"/> Trapping/Hunting       | <input checked="" type="checkbox"/> Architecture, Engineering and Decorative Arts |
| <input type="checkbox"/> Mining/Quarrying       | <input type="checkbox"/> Government   |
| <input type="checkbox"/> Fishing/Oystering      | <input type="checkbox"/> Religion   |
| <input type="checkbox"/> Manufacturing          | <input type="checkbox"/> Education  |
| <input type="checkbox"/> Retailing/Wholesaling  | <input type="checkbox"/> Community Organizations                                  |
| <input type="checkbox"/> Finance                | <input type="checkbox"/> Occupational Organizations                               |
| <input type="checkbox"/> Professional Services  | <input type="checkbox"/> Major Families, Individuals and Events                   |

USE BLACK INK ONLY

CRS-1

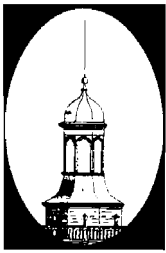

CULTURAL RESOURCE SURVEY  
MAIN BUILDING FORM

CRS # A-00001

1. ADDRESS/LOCATION: 299 Bowers Beach Road
2. FUNCTION(S): historic Dwelling current Dwelling
3. YEAR BUILT: 1940 CIRCA?: ☒ ARCHITECT/BUILDER: Unknown
4. STYLE OR FLOOR PLAN: Side-gable Cottage
5. INTEGRITY: original site ☐ moved ☒  
if moved, from where Moved from site of now-demolished Rainbow Inn (south side of Bowers Beach Road near US 113) other location's CRS # Not previously surveyed year 1948  
list major alterations and additions with years (if known) year  
a. East addition ca. 1950  
b. Screened-in porch ca. 1970
6. CURRENT CONDITION: excellent ☐ good ☒ fair ☐ poor ☐
7. DESCRIPTION: (Describe the resource as completely as possible. Use N/A for not applicable; leave no blanks.)  
a. Overall shape: Side gable with front shed-roof Stories: One and one-half  
Additions: A one-bay-wide by two-bay-deep, shed-roof, asbestos shingle-clad addition is lit by one-over-one light, double-hung sash, and wood windows and extends from the east elevation. At the southwest corner is a porch enclosed with wood-framed screens that rests on a concrete block foundation and features a poured-concrete deck.  
B Structural system (if known): Frame  
c. Foundation: materials: Concrete block  
basement: full ☒ partial ☐ not visible ☐ no basement ☐  
d. Exterior walls (original if visible & any subsequent coverings): Asbestos shingles  
e. Roof: shape: Side gable  
materials: Asphalt shingles  
cornice: Simple, wood  
dormers: N/A  
chimney: location(s): Off-center ridge, interior, brick
8. DESCRIPTION OF ELEVATIONS:  
a. Facade: Direction: South  
1) Bays Five (5)  
2) Windows 4  
Fenestration Irregular  
type (3) 1/1 double-hung sash wood; (1) paired 1/1 double-hung sash wood  
trim Wood  
shutters N/A


**Facade (cont'd)**

- 3) Door(s) 1
    - location Center
    - type Aluminum screen door; main door not visible
    - trim Wood
  - 4) Porch(es) Wrought iron railing flanks a brick stoop; awning covered with corrugated metal
- b. Side: Direction: East
- 1) Bays Four (4)
  - 2) Windows 6; 5 first-story; 1 half-story
    - Fenestration Regular
    - type (3) 1/1 double-hung sash wood; (1) 1/2 double-hung sash aluminum;
    - (2) paired 1/1 double-hung sash wood
    - trim Wood
    - shutters N/A
  - 3) Door(s) 0
    - location N/A
    - type N/A
    - trim N/A
  - 4) Porch(es) N/A
- c. Side: Direction: West
- 1) Bays Two (2)
  - 2) Windows 4
    - Fenestration Regular
    - type (2) sets of 1/1 paired double-hung sash wood
    - trim Wood
    - shutters N/A
  - 3) Door(s) 0
    - location N/A
    - type N/A
    - trim N/A
  - 4) Porch(es) Screened-in porch addition conceals the southernmost bay in the west elevation.
- d. Rear: Direction: North
- 1) Bays Four (4)
  - 2) Windows 3
    - Fenestration Irregular
    - type (1) 1/1 double-hung sash wood; (2) paired 1/1 double-hung sash wood
    - trim Wood
    - shutters N/A
  - 3) Door(s) 2
    - location 1<sup>st</sup> bay of dwelling; screened-in porch
    - type Aluminum storm; wood screen
    - trim Wood
  - 4) Porch(es) Simple concrete pad at base of each door

9. **INTERIOR:** Not accessible.

10. **LANDSCAPING:** Minimal landscaping around property. Shrubs flank façade entrance and the property is dotted with a few mature trees.

11. **OTHER COMMENTS:** House was moved to this location in 1948 from a site on the south side of Bowers Beach Road at its intersection with US 113 (near where the Rainbow Inn was located before it was demolished).

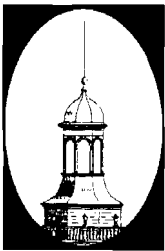

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # A-00001

1. ADDRESS/LOCATION: 299 Bowers Beach Road
2. FUNCTION(S): historic Garage current Garage
3. YEAR BUILT: 1950 CIRCA?: ☒ ARCHITECT/BUILDER: Unknown
4. STYLE/FLOOR PLAN: Open
5. INTEGRITY: original site ☒ moved ☐
- | <u>if moved, from where</u>                                       | <u>original location's CRS #</u> | <u>year</u> |
|---|----------------------------------|-------------|
| N/A   | N/A                              | N/A         |
| N/A   | N/A                              | N/A         |
| <u>list major alterations and additions with years (if known)</u> |                                  | <u>year</u> |
| a. Shed roof side addition  |                                  | ca. 1970    |
| b. Shed roof rear addition  |                                  | ca. 1970    |
6. CURRENT CONDITION: excellent ☐ good ☒ fair ☐ poor ☐
7. DESCRIPTION:
- a. Structural system Core-concrete block; additions-frame
- b. Number of stories 1
- c. Wall coverings Core-concrete block; side addition and gables in core-asbestos shingle; rear addition-tar paper
- d. Foundation Core-not visible; Additions-concrete block
- e. Roof  
structural system Frame  
coverings Core-standing seam metal; additions-asphalt shingle and corrugated metal  
openings N/A
8. DESCRIPTION OF ELEVATIONS:
- a. Facade: direction: South
- 1) bays: 4
- 2) windows: (1) 1/1 aluminum
- 3) door(s): (3) 12-light sliding wood doors on overhead metal track
- 4) other: N/A

**b. Side: direction: East**

- 1) bays: 2
- 2) windows: (1) 2-light metal
- 3) door(s): (1) flush wood in addition
- 4) other: concrete pad at door, entry sheltered by a shed-roof hood supported by wood post

**c. Side: direction: West**

- 1) bays: 4
- 2) windows: (3) 1/1 aluminum; (1) screen in wood frame
- 3) door(s): 0
- 4) other: N/A

**d. Rear: direction: North**

- 1) bays: 3
- 2) windows: (1) plate glass; (1) 1/1 aluminum
- 3) door(s): (1) aluminum storm door
- 4) other: N/A


**9. INTERIOR (if accessible):**

**a) Floor plan**                      **Not accessible**

**b) Partition/walls**                      **Not accessible**

**c) Finishes**                      **Not accessible**

**d) Furnishings/machinery**                      **Not accessible**

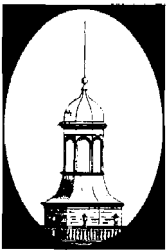

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # A-00001

1. ADDRESS/LOCATION: 299 Bowers Beach Road
2. FUNCTION(S): historic Chicken house 1 current Vacant
3. YEAR BUILT: 1950 CIRCA?: ☒ ARCHITECT/BUILDER: Unknown
4. STYLE/FLOOR PLAN: Open
5. INTEGRITY: original site ☒ moved ☐  
if moved, from where original location's CRS # year  
N/A N/A N/A  
N/A N/A N/A  
list major alterations and additions with years (if known) year  
a. East wing ca. 1960  
b. West wing ca. 1960
6. CURRENT CONDITION: excellent ☐ good ☐ fair ☒ poor ☐
7. DESCRIPTION:
- a. Structural system Unknown
- b. Number of stories 1
- c. Wall coverings sheets of wood siding (unknown)
- d. Foundation Not visible
- e. Roof  
structural system Frame  
coverings Asphalt  
openings N/A
8. DESCRIPTION OF ELEVATIONS:
- a. Facade: direction: South
- 1) bays: Fifteen (15)
- 2) windows: (7) awning-sash single light in wood frames; (1) set of paired, awning-sash single-light in wood frame; (1) 12-light metal picture window; (2) 1/1 aluminum sash
- 3) door(s): (3) flush wood doors; (1) paneled wood with lights
- 4) other: N/A

- b. Side: direction: East
  - 1) bays: Two (2)
  - 2) windows: (2) fixed single light in wood frame
  - 3) door(s): 0
  - 4) other: N/A
  
- c. Side: direction: West
  - 1) bays: Zero (0) – blank wall
  - 2) windows: 0
  - 3) door(s): 0
  - 4) other: N/A
  
- d. Rear: direction: North
  - 1) bays: 7
  - 2) windows: (6) fixed single light in wood frames
  - 3) door(s): (1) opening screened over
  - 4) other: N/A

9. INTERIOR (if accessible):

a) Floor plan                      Not accessible

b) Partition/walls                Not accessible

c) Finishes                        Not accessible

d) Furnishings/machinery        Not accessible



DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # A-00001

1. ADDRESS/LOCATION: 299 Bowers Beach Road
2. FUNCTION(S): historic Chicken house 2 current Vacant
3. YEAR BUILT: 1960 CIRCA?: ☒ ARCHITECT/BUILDER: Unknown
4. STYLE/FLOOR PLAN: Open
5. INTEGRITY: original site ☒ moved ☐  
if moved, from where original location's CRS # year  
N/A N/A N/A  
N/A N/A N/A  
list major alterations and additions with years (if known) year  
a. N/A N/A  
b. N/A N/A
6. CURRENT CONDITION: excellent ☐ good ☐ fair ☒ poor ☐
7. DESCRIPTION:
- a. Structural system Frame
- b. Number of stories 1
- c. Wall coverings Wood
- d. Foundation Not visible
- e. Roof  
structural system Frame  
coverings Corrugated metal  
openings N/A
8. DESCRIPTION OF ELEVATIONS:
- a. Facade: direction: West  
1) bays: 2  
2) windows: (1) rectangular wood frame opening covered with chicken wire  
3) door(s): (1) batten wood  
4) other: N/A



**b. Side: direction: North**

- 1) bays: 0 – blank wall
- 2) windows: 0
- 3) door(s): 0
- 4) other: N/A

**c. Side: direction: South**

- 1) bays: 0 – blank wall
- 2) windows: 0
- 3) door(s): 0
- 4) other: N/A

**d. Rear: direction: East**

- 1) bays: 0 – blank wall
- 2) windows: 0
- 3) door(s): 0
- 4) other: 0


**9. INTERIOR (if accessible):**

**a) Floor plan**                      **Not accessible**

**b) Partition/walls**                      **Not accessible**

**c) Finishes**                      **Not accessible**

**d) Furnishings/machinery**                      **Not accessible**

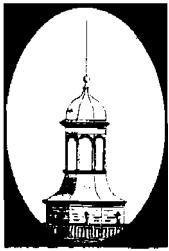

DELAWARE STATE HISTORIC PRESERVATION OFFICE  
15 THE GREEN, DOVER, DE 19901

CULTURAL RESOURCE SURVEY  
SECONDARY BUILDING FORM

CRS # A-00001

1. ADDRESS/LOCATION: 299 Bowers Beach Road
2. FUNCTION(S): historic Chicken house 3 current Storage/Vacant
3. YEAR BUILT: 1960 CIRCA?: ☒ ARCHITECT/BUILDER: Unknown
4. STYLE/FLOOR PLAN: Open
5. INTEGRITY: original site ☒ moved ☐  
if moved, from where original location's CRS # year  
N/A N/A N/A  
N/A N/A N/A  
list major alterations and additions with years (if known) year  
a. N/A N/A  
b. N/A N/A
6. CURRENT CONDITION: excellent ☐ good ☐ fair ☒ poor ☐
7. DESCRIPTION:
- a. Structural system Unknown
- b. Number of stories 1
- c. Wall coverings Metal (covered in overgrowth)
- d. Foundation Not visible
- e. Roof  
structural system Frame  
coverings Not visible (covered in overgrowth)  
openings N/A
8. DESCRIPTION OF ELEVATIONS:
- a. Facade: direction: South  
1) bays: Not visible  
2) windows: Not visible  
3) door(s): Not visible  
4) other: Not visible

**b. Side: direction: East**

- 1) bays: 0 – blank wall
- 2) windows: 0
- 3) door(s): 0
- 4) other: N/A

**c. Side: direction: West**

- 1) bays: 0 – blank wall
- 2) windows: 0
- 3) door(s): 0
- 4) other: N/A

**d. Rear: direction: North**

- 1) bays: Not visible
- 2) windows: Not visible
- 3) door(s): Not visible
- 4) other: Not visible

**9. INTERIOR (if accessible):**

**a) Floor plan**                      Not accessible

**b) Partition/walls**                      Not accessible

**c) Finishes**                      Not accessible

**d) Furnishings/machinery**                      Not accessible

# CULTURAL RESOURCE SURVEY MAP FORM


**CRS #      A-00001**

1. ADDRESS/LOCATION: 299 Bowers Beach Road
2. NOT FOR PUBLICATION ☐ reason: \_\_\_\_\_
3. LOCATION MAP: \_\_\_\_\_

**Indicate position of resource in relation to geographical landmarks such as streams and crossroads.**

(attach section of USGS quad map with location marked or draw location map )


**INDICATE NORTH ON SKETCH**

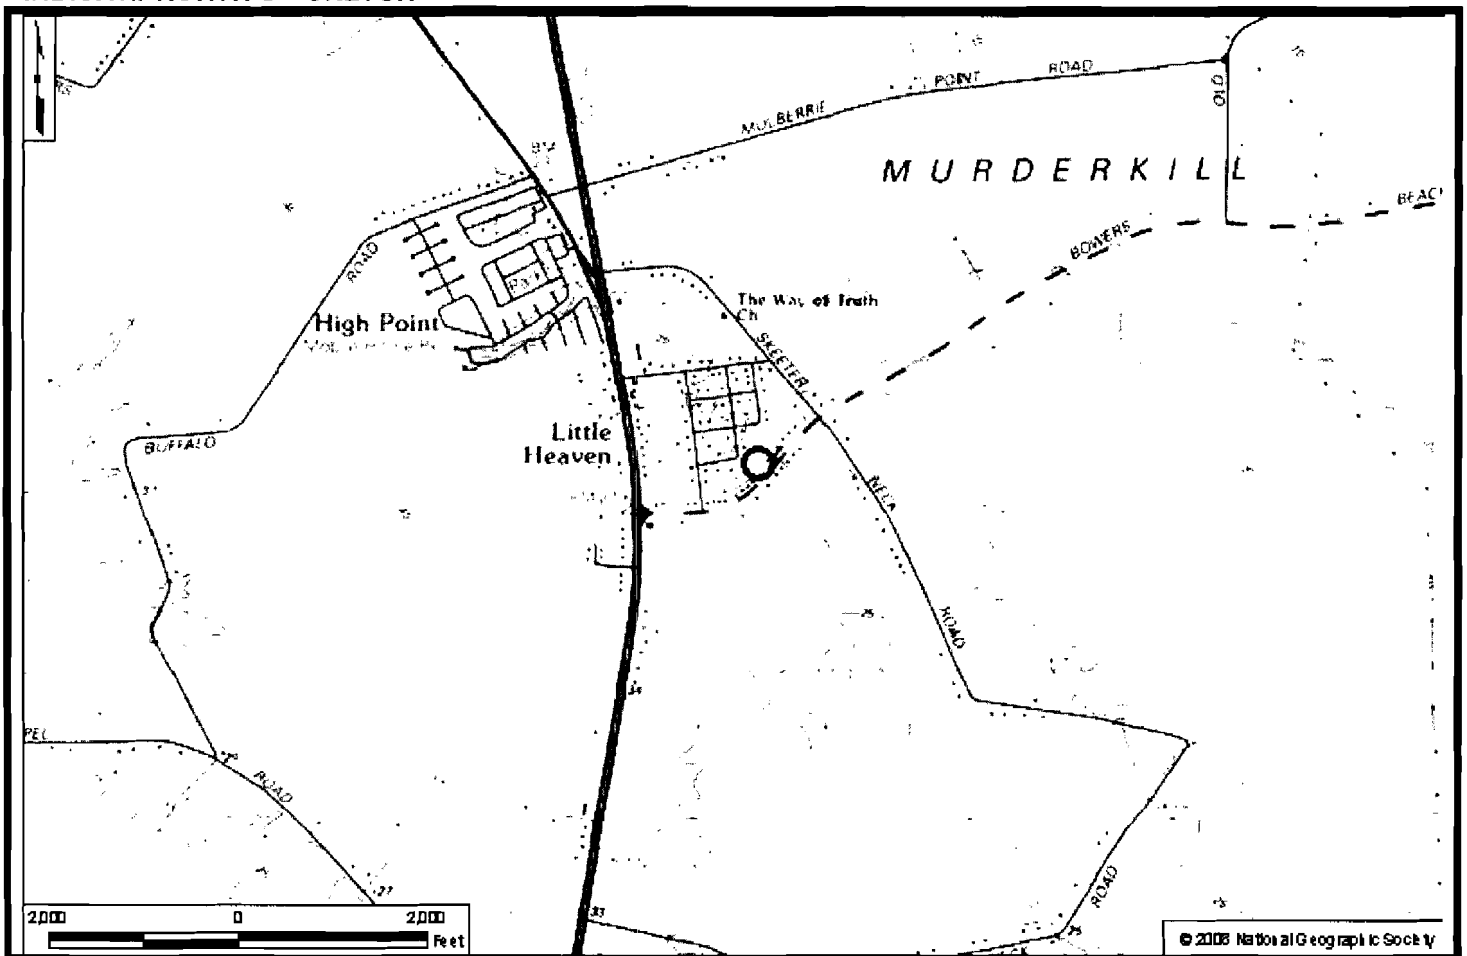

4. SITE PLAN:

CRS # A-00001

INDICATE NORTH ON PLAN

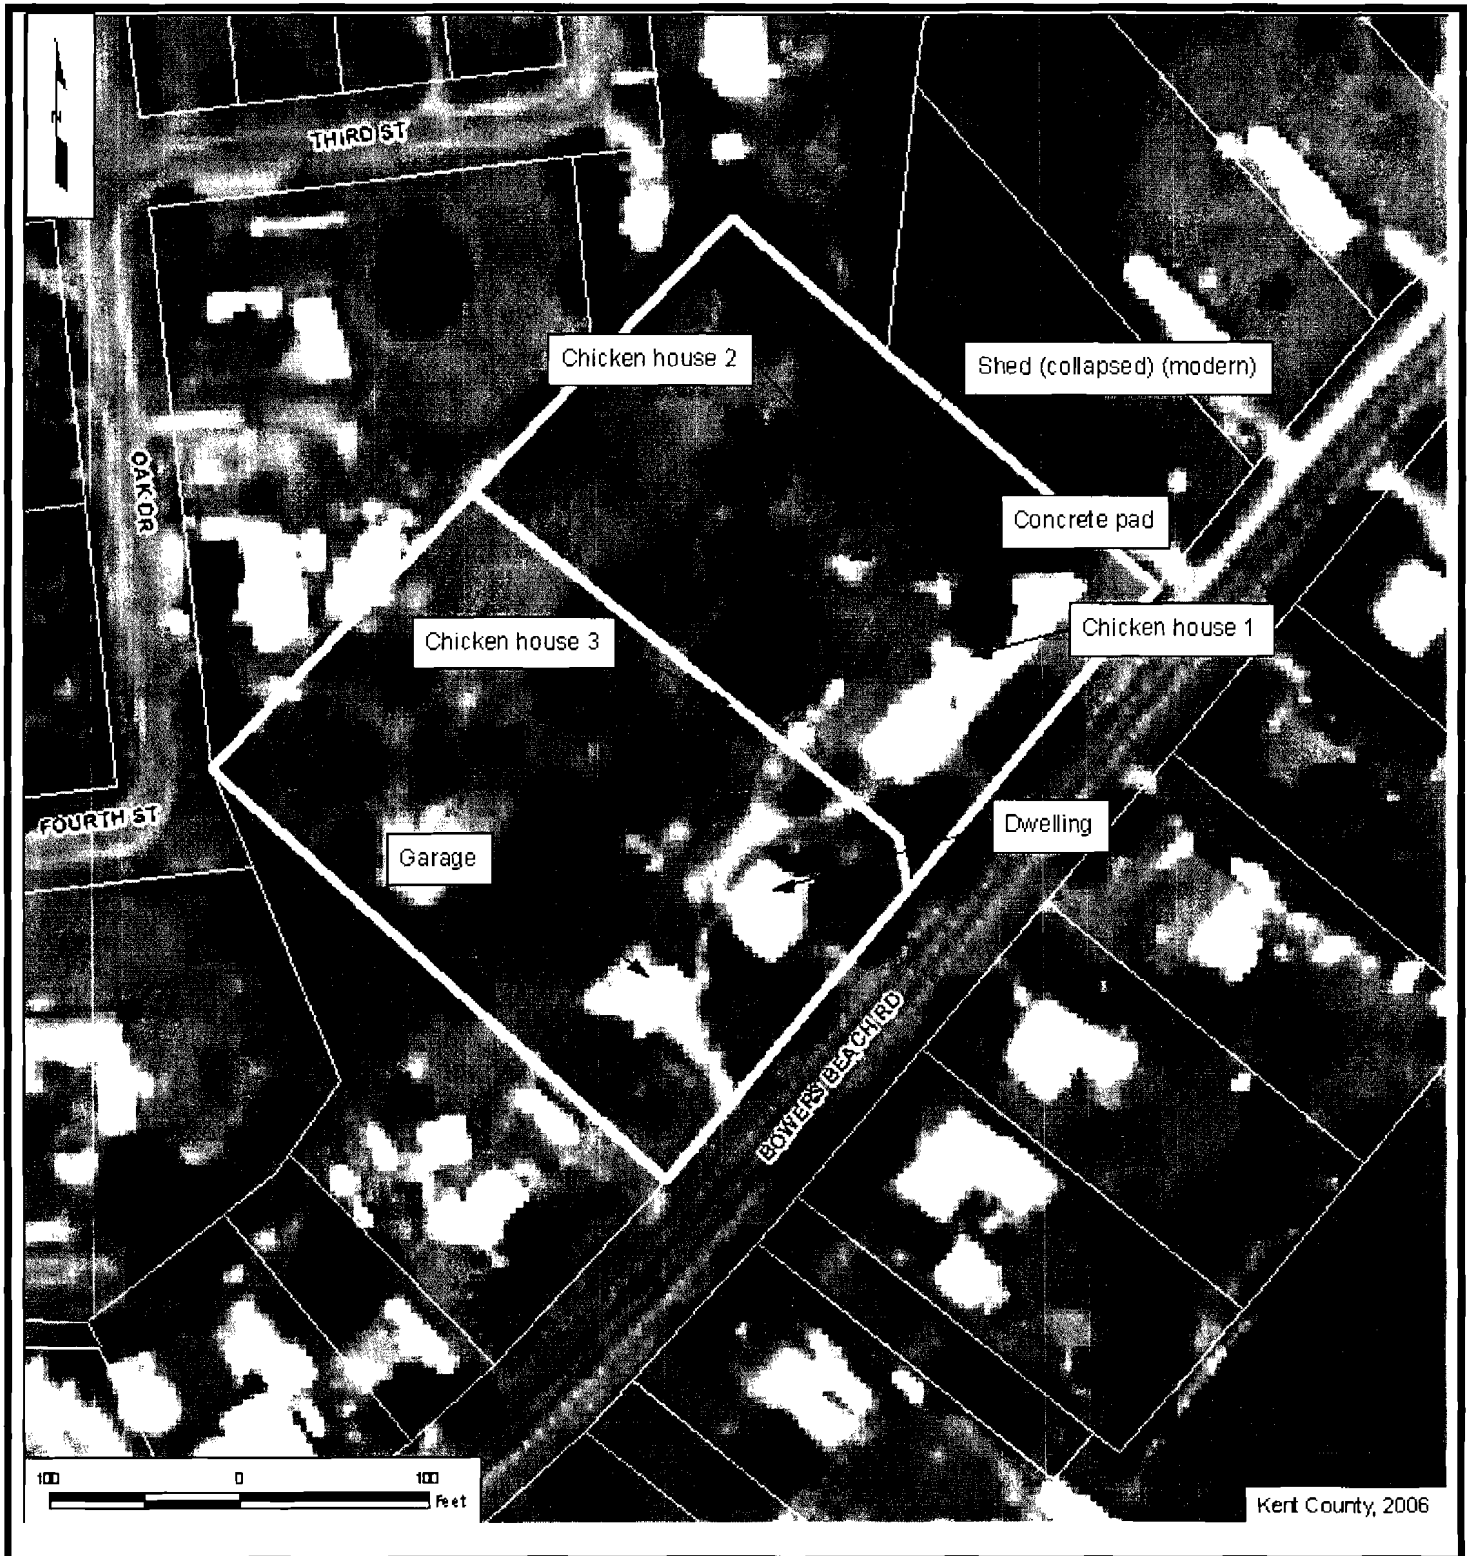

USE BLACK INK ONLY